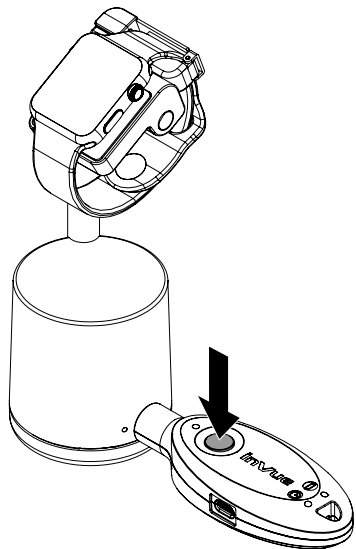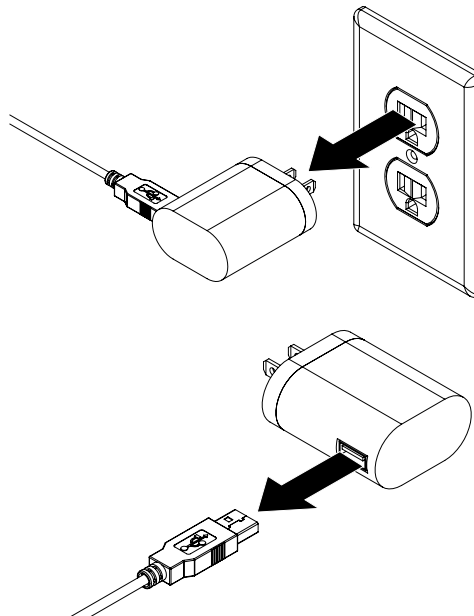# InVue.

W2000
Merchandising Guide

1 Place a charged and coded OneKEY against the lens on the side of the stand. Press the button on the key to deactivate the stand.
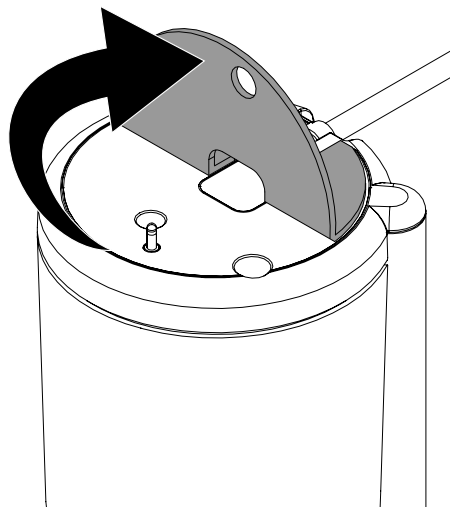

2 Unplug the stand's power cable into a PS515 power supply and unplug the power supply into a power outlet.
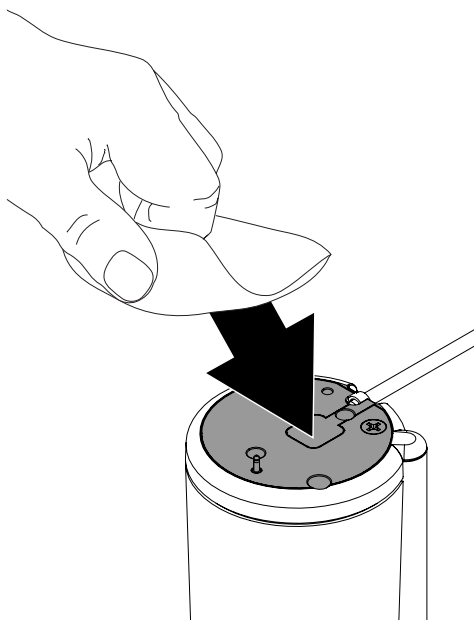

3a If removing the stand from the position, use the scraper removal tool (DNTX93) to break the adhesive bond between the stand and the fixture surface.
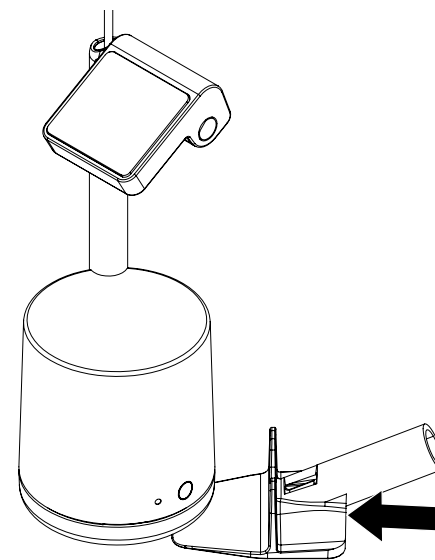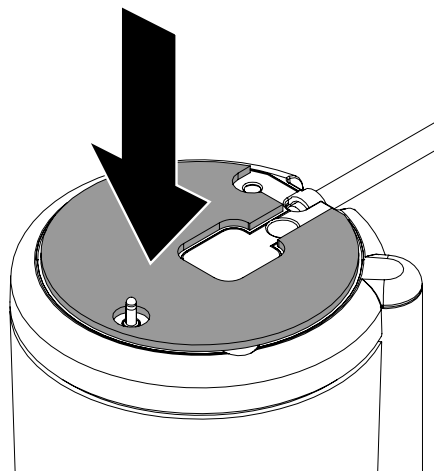

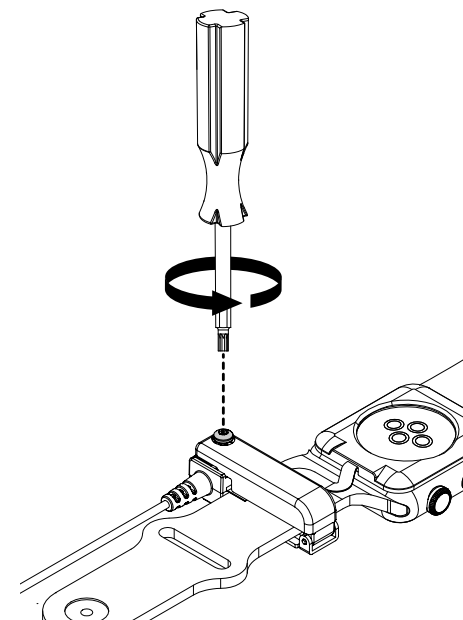**3b** If the W2000 stand will be reinstalled, peel the old adhesive from the stand.

3c Use an alcohol wipe to clean any adhesive residue from the bottom of the stand. Allow it to dry completely.
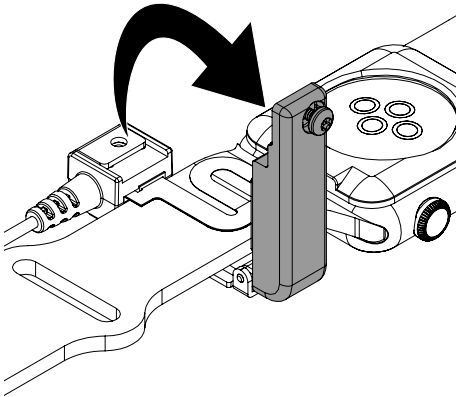

3d Remove one of the replacement adhesives (ADH2321) from it's backing and align it with the bottom of the stand. Smooth it into place for at least 10 seconds.
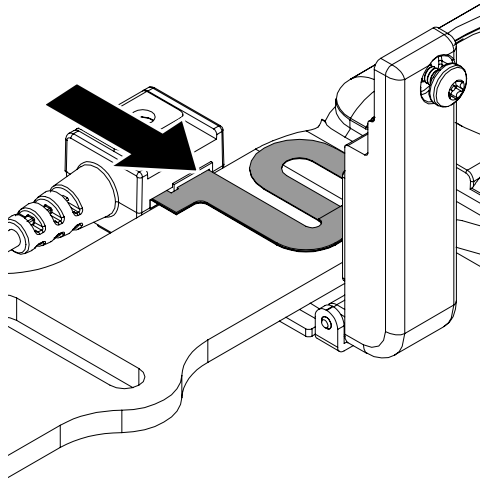**Note:** The stand is now ready to be reinstalled. Consult the installation guide for more information.

4 Use a TT8 bit to loosen the screw in the band clamp. Do NOT attempt to fully remove the screw.
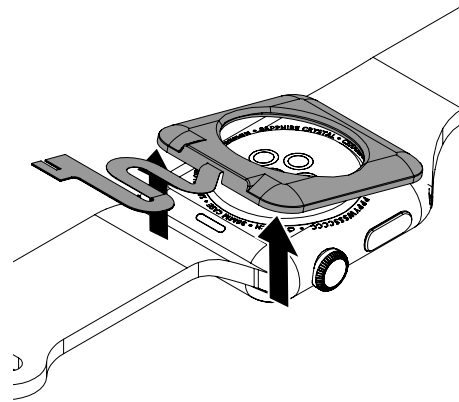
5 Lift the band clamp

6 Unplug the tray or flex sensor from the port inside the band clamp.

7 Remove the tray sensor by carefully prying up one side by hand. Continue lifting the tray sensor from the watch until it is removed.

8 Use an alcohol wipe to clean any adhesive residue from the bottom of the watch. Allow it to dry completely. **Note:** The watch is now ready to be reinstalled. Consult the installation guide for more information.
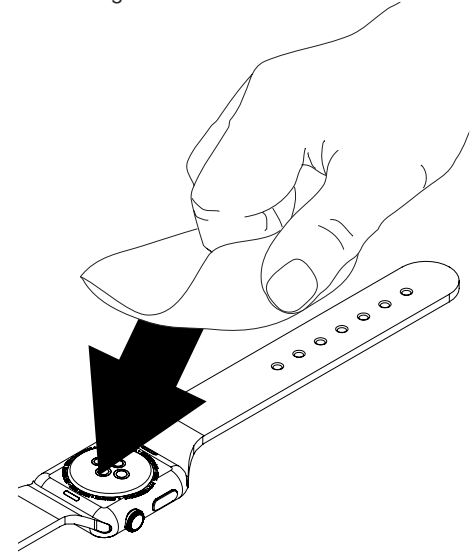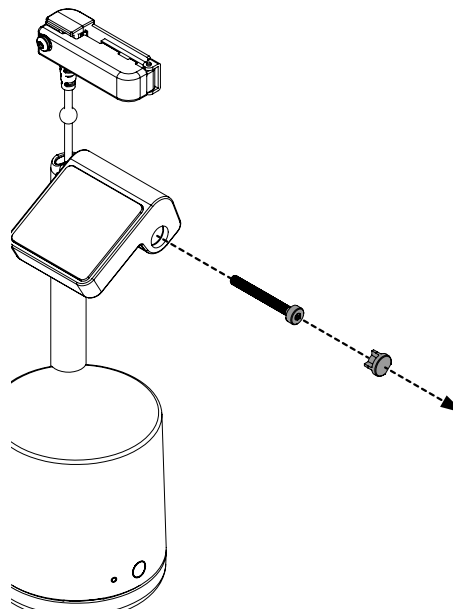
Rev0 08/03/22

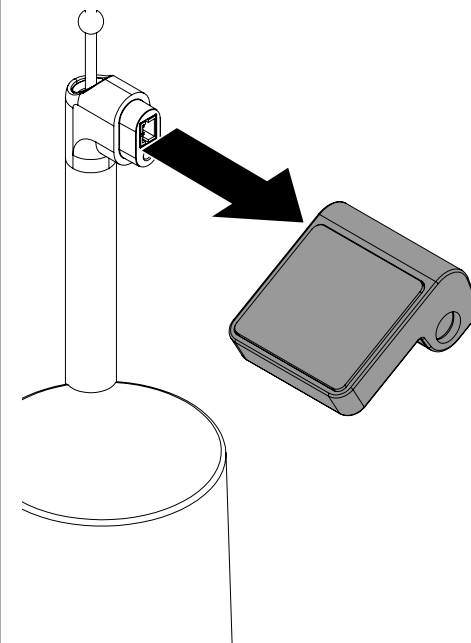**5** Place the stand in the desired location and apply pressure for at least 10 seconds.
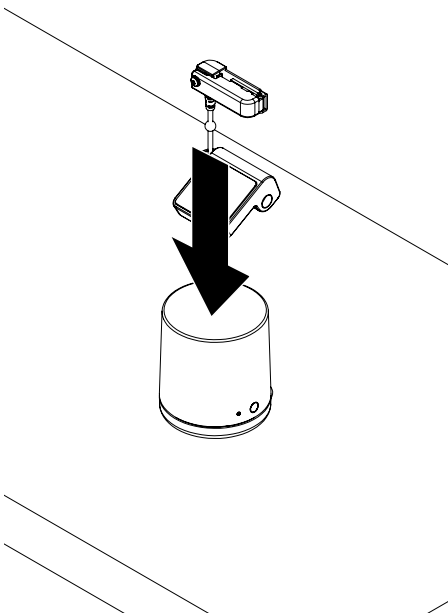
6a **Custom Charger Installation:** If installing a custom charger cradle, use a key fob tool to remove the plug from the side of the cradle.
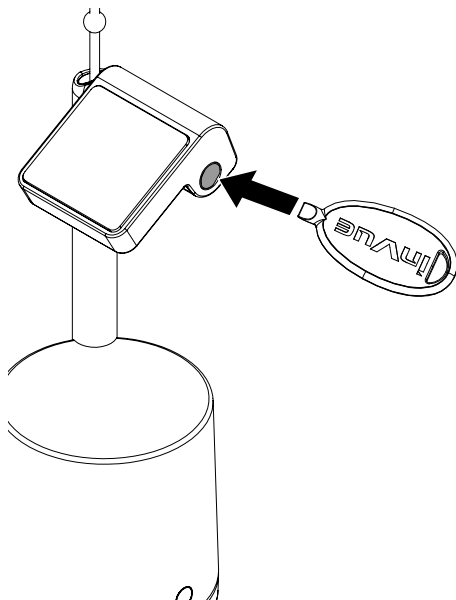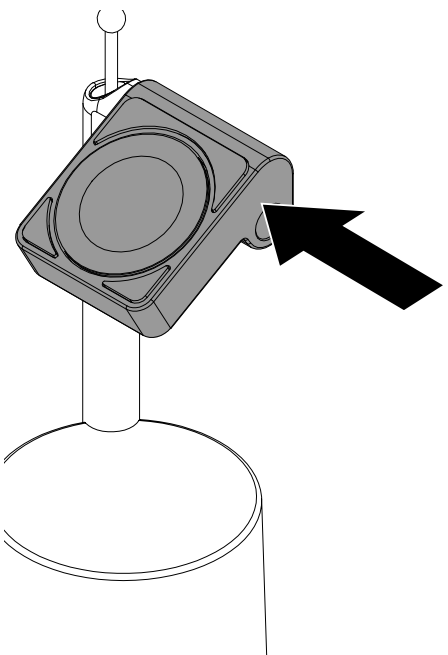
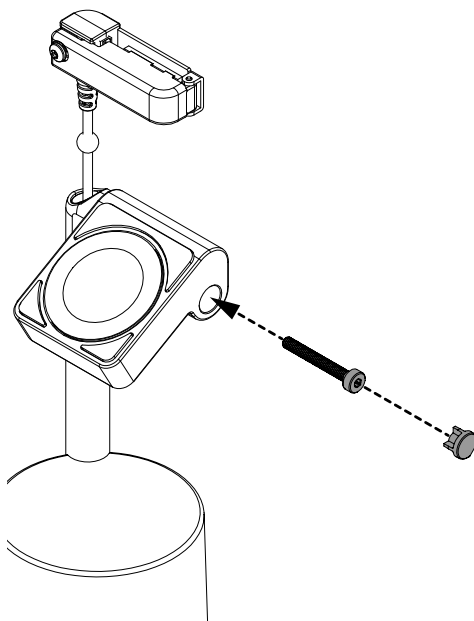**6b** Remove the plug and screw from the side of the cradle.

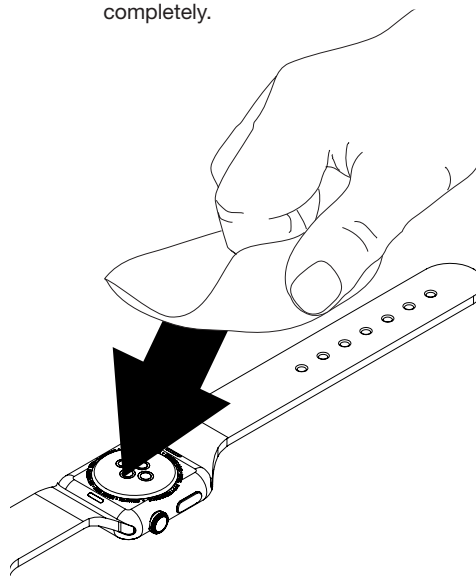**6c** Remove the original cradle from the stand.

6d Place the custom charger cradle onto the stand.

6e Secure the custom charger cradle with the screw. Insert the plug into the hole in the side on the cradle.
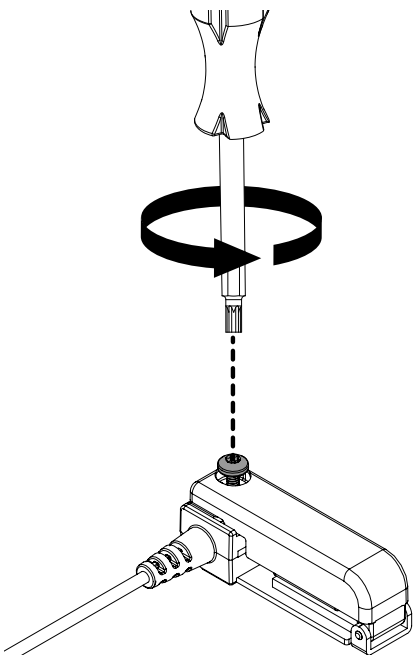
7 Use the provided alcohol wipe to clean the underside of the wearable that will be displayed. Allow it to dry completely.
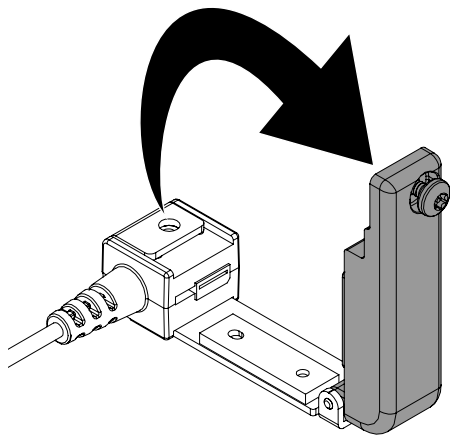
8 Lift the band clamp from the stand, pulling enough cable to aid in the installation of the wearable. Snap the included cable stop clip around the cable to prevent it from retracting.
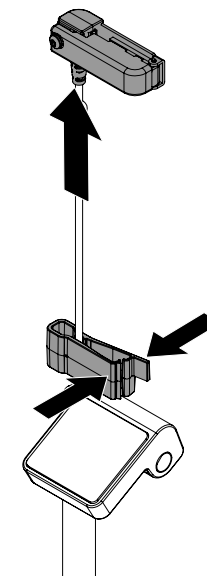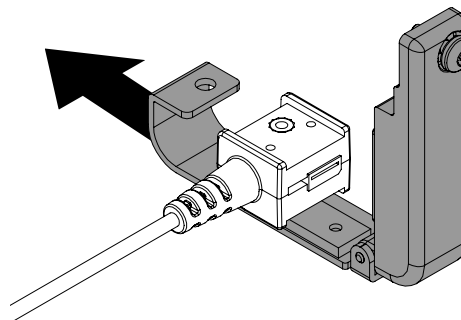
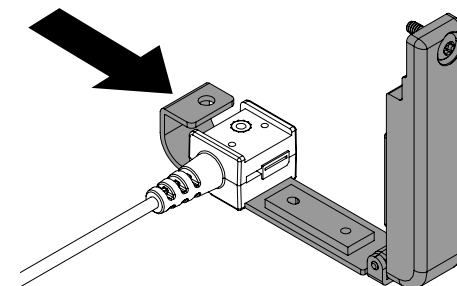**9** Use a TT8 bit to loosen the screw in the band clamp.
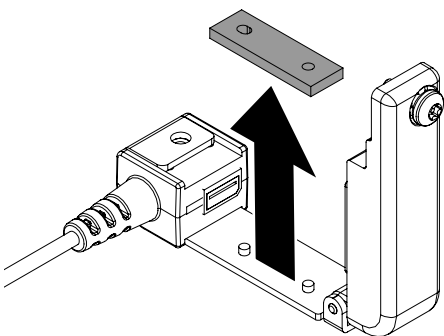
10 Open the band clamp.

11a **Large Band Clamp Installation:** If the wearable being displayed has a band that is too large to fit in the standard band clamp, slide the band clamp off of the sensor.

**11b** Slide the large band clamp onto the sensor. Proceed with the installation as normal.

12a **Alternate Pad Installation:** If the wearable being displayed has a band that is too thick or too thin to be held securely in the band clamp, remove the preinstalled pad from the band clamp.

12b Use an alcohol wipe to clean the area where the pad was. Ensure that all of the adhesive residue is removed. Allow it to dry completely.
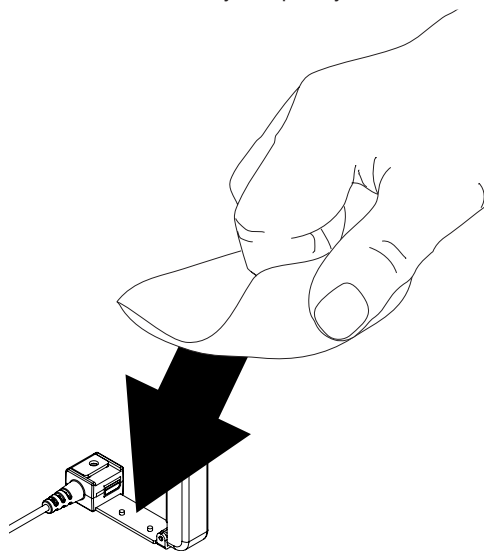
12c Select the pad from the kit that will allow the wearable to be held securely in the band clamp. Remove the appropriate pad from its backing.
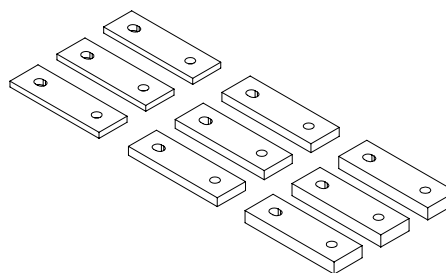
12d Place the new pad onto the band clamp. Align the holes on the pad with the posts on the band clamp. Apply pressure for at least 10 seconds.
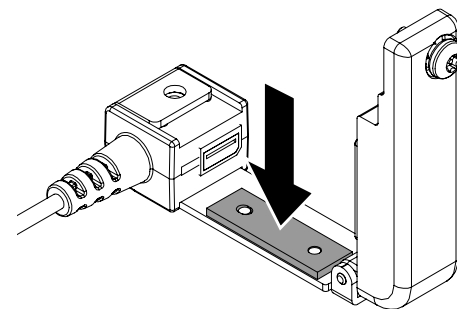
13 With the watch in its normal orientation, identify the back band. This will be the band that will be installed into the band clamp.
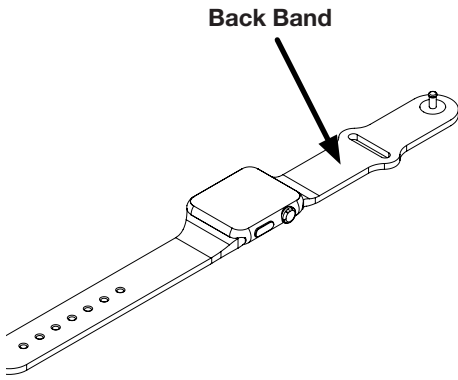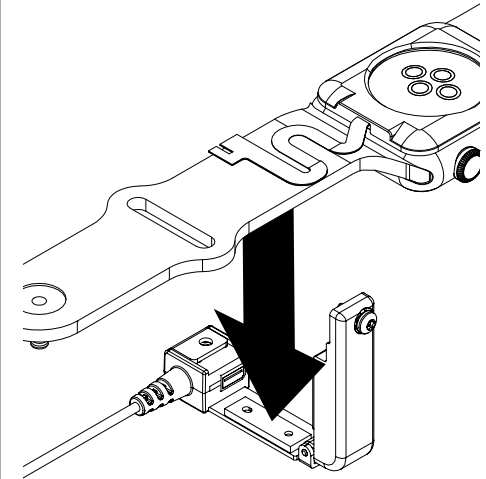
Back Band

14a **Custom Tray Flex Sensor Installation:**
Using the pull tab, peel the liner from the adhesive in the tray flex sensor.
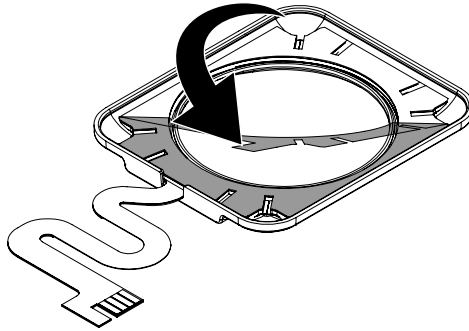
14b Place the tray flex sensor onto the bottom of the wearable. Make sure that the connector is facing towards the back band. Apply pressure for at least 10 seconds.
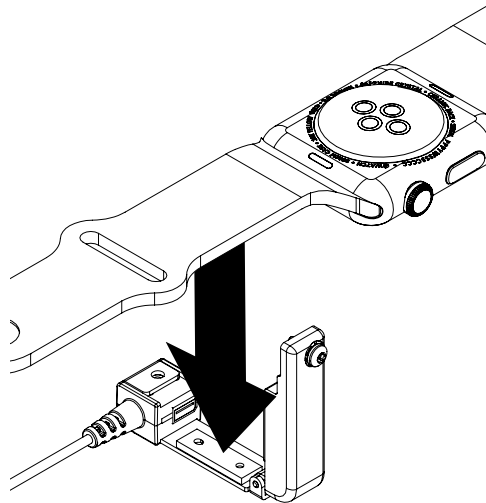
Connector
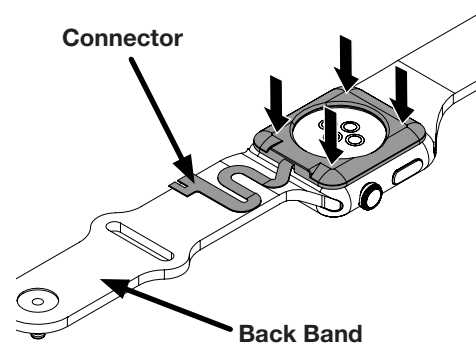
Back Band

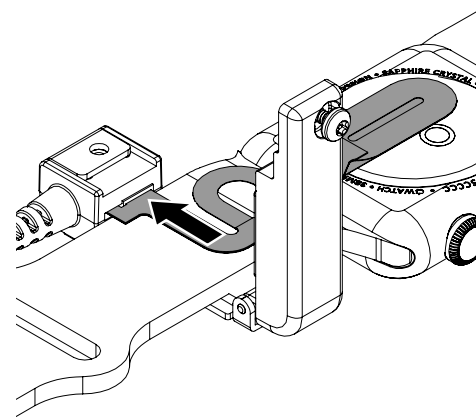**14c** Place the back band into the open band clamp.

14d Plug the tray flex sensor connector into the port on the inside of the band clamp.
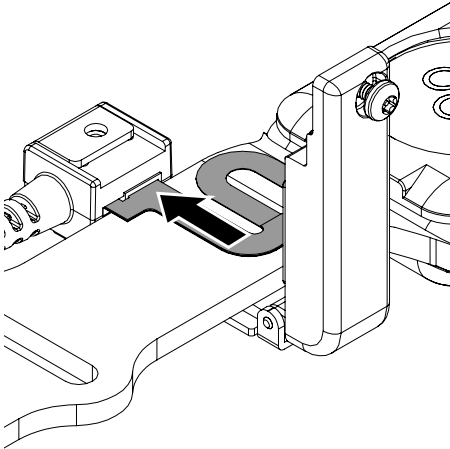
**15a** **Universal Flex Sensor Installation:**
Place the back band of the wearable into the open band clamp.

15b Plug the universal flex sensor into the port on the inside of the band clamp over the wearable.


15c Adjust the wearable so that the area between the 2 white lines on the flex sensor (the shaded area in the below image) will sit over the "hinge" area (the area where the band connects to the watch body) of the wearable.
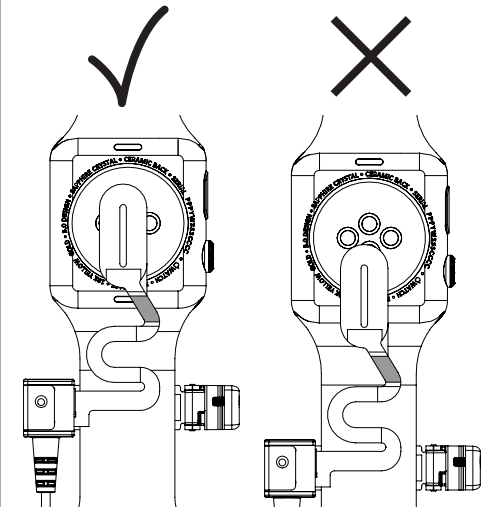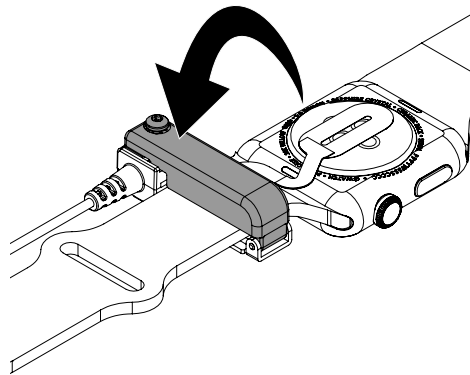
**15d** Peel the liner from the adhesive portion of the flex sensor.
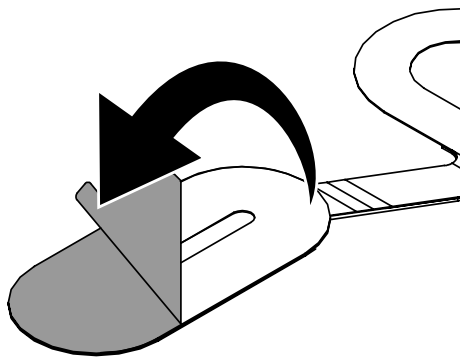
15e Press the flex adhesive against the bottom of the wearable for at least 10 seconds. Ensure that all of the oval is adhered to the wearable and that no gap is visible.
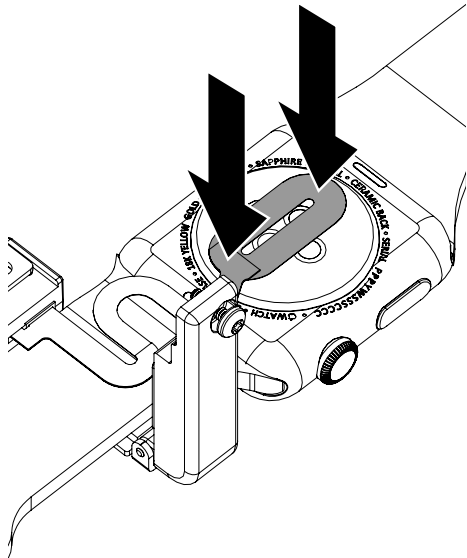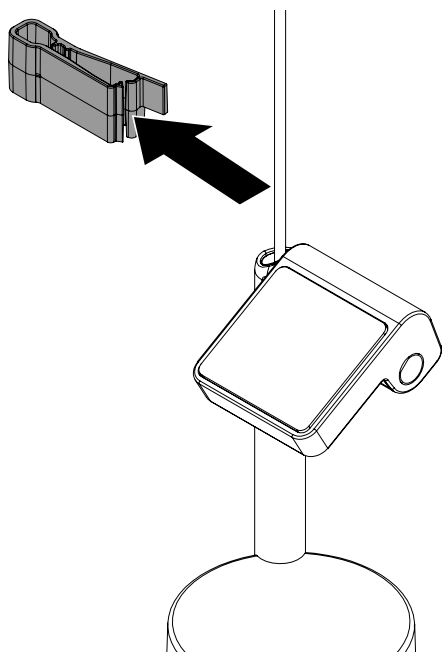
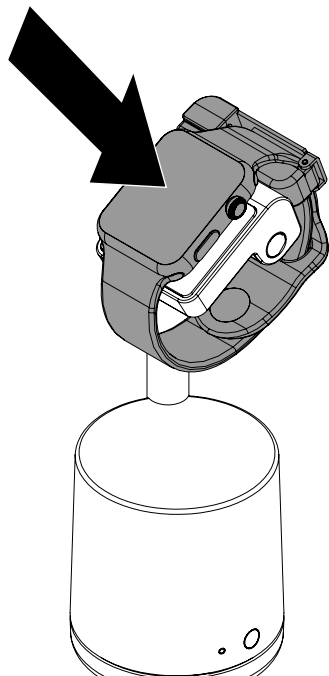**16** Close the band clamp over the watch band and flex sensor.

17 Press down on the band clamp and use a TT8 bit to tighten the screw in the band clamp. Do NOT overtighten.
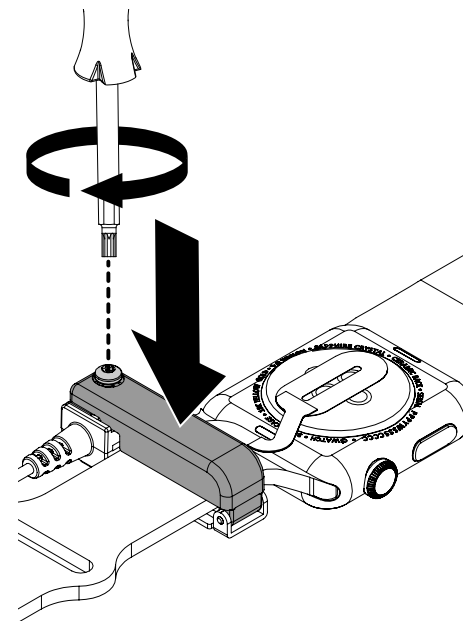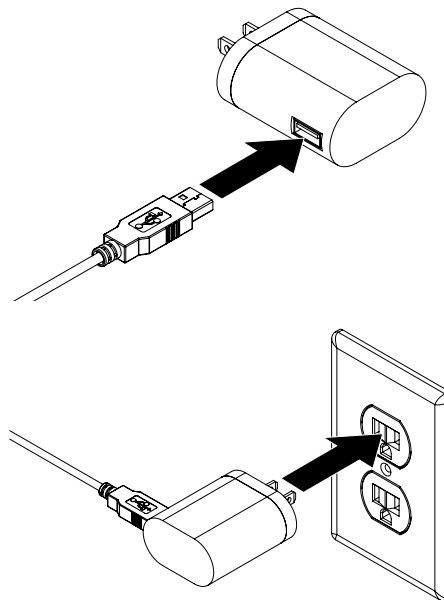
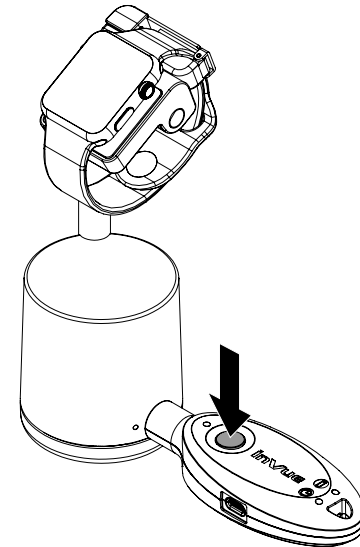**18** Remove the cable stop clip from the cable.

19 Place the wearable onto the cradle.

20 Plug the stand's power cable into a PS515 power supply and plug the power supply into a power outlet.

21 Place a charged and coded OneKEY against the lens on the side of the stand. Press the button on the key to transfer the code to the stand. This method is also used to deactivate the alarm.

InVue